

**Date:** October 10, 2007

**Models:** 2007 - 2008 DR Ram Truck, (DH/DI/DC) Ram Truck (2500 & 3500)

2007 - 2008 (LE) 300, Touring (international Markets)

2007 - 2008 (LX) 300, Charger, Magnum

2007 (L2) 300 (China)

2007 - 2008 (JS) Avenger/Sebring/Sebring Convertible

2007 - 2008 (MK) Compass/Patriot

2007 - 2008 (PM) Caliber

2007 - 2008 (WK) Grand Cherokee

2007 - 2008 (WH) Grand Cherokee (international Markets)

2007 - 2008 (XK) Commander

2007 - 2008 (XH) Commander (international markets)

2007 - 2008 (DR) Ram truck

2007 - 2008 (DH/DI/DC) Ram Truck (2500 & 3500)

2008 (RT) Town & Country/Grand Caravan/Grand Voyager (U.S. and International Markets)

NOTE: This bulletin applies to vehicles built between February 26, 2007 (MDH 0226XX) and September 4, 2007 (MDH 0904XX) and sales code RCB, RCG or RCD

### Overview:

This bulletin involves replacing all 6x9" base (non-premium sound system) speakers in the vehicle.

### Symptom/Condition:

Some customers may experience a "distorted sound" in one or more 6x9" (non-premium sound system) speakers with the radio on.

### Diagnosis:

If the Symptom/Condition is present, perform the Repair Procedure.

### Parts Required:

Qty.	Part No.	Description
AR	05064035AB	6x9 Speaker
AR	05091019AB	6x9 Speaker
AR	56040860AB	6x9 Speaker

### Repair Procedure:

1. Replace all the 6x9 speakers in the vehicle following the procedures available in DealerCONNECT > TechCONNECT > 8 - Electrical > Radio > Speaker > Removal and Installation. Refer to table below for 6x9 speaker quantities and location details.

Mode I	Radio Sales Code	Part No.	6x9 Vehicle Speaker Qty.	Speaker Location
LX	RCD or RCG	05064035A B	2	Front Doors

PM	RCD	05091019A B	2	Rear Shelf
MK	RCD	05091019A B	4	All 4 Doors
JS-41	RCD or RCG	05091019A B	4	All 4 Doors
JS-27	RCD or RCG	05091019A B	4	Front Doors and Rear Shelf
WK	RCG	05091019A B	2	Front Doors
XK	RCG	05091019A B	2	Front Doors
DR	RCD	56040860A B	2	Front Doors
DH	RCD	56040860A B	2	Front Doors
DC	RCD	56040860A B	2	Front Doors
D1	RCD	56040860A B	2	Front Doors
RT	RCD or RCG	05091019A B	4	Front Doors and Rear Quarter Trim
	RCB	05091019A B	2	Front Doors

**Policy:** Reimbursable within the provisions of the warranty.

**Time Allowance:**

Labor Operation No:	Description	Amount
08-60-70-95	Speaker, Sound System - Replace Two Speakers (B)	DR/DH/DC/D1 0.5 Hrs. RT/XK/XH/WK/WH 0.5 Hrs. JS-27 0.4 Hrs.
08-60-70-96	Speaker, Sound System - Replace Four Speakers	LX/LE 1.2 Hrs. PM/MK 0.5 Hrs.

	(B)	RT/JS-41 0.9 Hrs.
--	-----	-------------------

**Failure Code:**

ZZ	Service Action
----	----------------